

Document Number: 070-90041

Revision: A.0

Last Date Changed: 06/01/2016

Page 1 of 5

Download the Firmware Update Utility

The Firmware Update Utility may be downloaded from the Mark Levinson Website.

Install the Firmware Update Utility on your Windows computer.

Check Current Firmware Version

Connect your ML Product to your computer via USB, wait for your ML Product to be recognized by your computer.

Start the Firmware Update Utility.

vpe:	CM6632	Type:	110	
//	C1010032	Type.		
ID:	0ECB	VID:		
ID:	18A7	PID:		_
W:	0104	FW:		

The Firmware Update Utility shows the current Firmware Version in the FW: box on the left, in this case 0104. The VID (Vendor ID) and PID (Product ID) are also shown. The Type window shows the device type that will be updated.

The existing firmware must be erased before new firmware can be installed. Click the Erase FW Button on the Firmware Update Tool.



Document Number: 070-90041

Revision: A.0

Last Date Changed: 06/01/2016

Page 2 of 5

Device	info	- HEX Info
Type:	CM6632	Туре:
VID:	0ECB	VID:
PID:	18A7	PID:
FW:	0104	FW:

The Firmware Update Utility will ask for confirmation to erase the firmware, click the OK Button.



The Firmware Tool and USB Device will need to be restarted at this point, follow the instructions below.

Click OK to continue with the tool.



Close the firmware update tool by clicking on the red "X" in the top right corner of the tool.

Remove and Re-Insert (re-plug) the USB cable from the ML Product.

Wait for the computer's USB Driver to Re-Install, it will fail and indicate the driver was not installed properly; this is OK since the firmware is now erased.



Document Number: 070-90041

Revision: A.0

.0 La

Last Date Changed: 06/01/2016

Page 3 of 5

Restart the Firmware Update Tool.

Device Info	HEX Info
VID:	VID:
PID:	PID:
FW:	FW:
	Harter DW Second

This time there will be no information.

Device Info	HEX Info	
ype	Туре	1
nD:	VID:	-
no:	PID:	-
-w.	FW:	-

Click the Update Firmware Button.



Open the one file shown in the browser window if this is your first time updating. If you have done this before browse to the new firmware file that you downloaded.





This will install a boot loader (driver) into the erased part, not the firmware.



Once the boot loader (driver) is installed, re-plug the ML Product and click OK to install the firmware.

The firmware update progress is shown while the tool is updating the firmware.

evice Info	HEX Info	0
ype.	Type:	CM6632
ID:	VID:	0DBC
ID:	PID:	0316
W:	FW:	0105

When the firmware update is complete a confirmation window is displayed.



Re-plug the ML Product and then click OK.

Close the firmware update tool by clicking on the red "X" in the top right corner of the tool.

You are finished.





Last Date Changed: 06/01/2016

Document Number: 070-90041

Revision: A.0

: A.0

Page 5 of 5

The Firmware Update Tool can be re-started to check the new that the new version is installed, but this is not necessary.

evice l	info	HEX Info
ype:	CM6632	Туре:
ID:	0ECB	VID:
PID:	18A7	PID:
W:	0105	FW:

Close the firmware update tool by clicking on the red "X" in the top right corner of the tool.

	USB2.0 High-Speed True HD Audio Properties
HISTN001 Batteries Biometric Devices Biometric Devices Biuetooth Radios Computer Disk drives DVD/CD-ROM drives DVD/CD-R	USB2.0 High-Speed True HD Audio Properties General Driver Details USB2.0 High-Speed True HD Audio Device type: Sound, video and game controllers Manufacturer: HARMAN Location: Location 0 Device status This device is working property. OK Cancel